


TSB-Local

TSB No.	KGE09-61-V040-ED	TSB Type	General	Language	English
Distributor	(KMC)	Published	7/2/2009	Modified	
Model			Cee'd [ED]-(all)		
Area & Distributor			East Europe & Falcon Auto		
Gr./Sys./Comp			Рулевое управление / Электроусиление руля / ECU для EPS		
Subject			PART NUMBER CHANGE FOR STEERING COLUMN & EPS UNIT ASSEMBLY		

Description

This bulletin provides information about part number change for steering column & EPS unit assembly of cee'd (ED). Please refer to the below information when servicing this item.

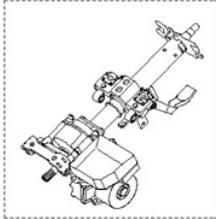

Effective Vehicle Information

- Model: cee'd (ED) all models (5Door, Sport Wagon, 3Door)
- Applicable vehicle production date range: From Job#1 ~
- Area : All except North America

Parts Information

Part Name	Part No.		Applicable vehicle
	Previous	New	
steering column & EPS unit assembly	563101H500	563101H500FFF	cee'd (ED) LHD -Tilt & Telescopic steering wheel
steering column & EPS unit assembly	563101H600	563101H600FFF	cee'd (ED) RHD -Tilt & Telescopic steering wheel
steering column & EPS unit assembly	563101H700	563101H700FFF	cee'd (ED) LHD -Tilt steering wheel only

Note)

The previous and new parts are all interchangeable each other.

Service Tip

While replacing the steering column & EPS unit Assembly, be sure to use correct tightening torque for the bolt (A) when assembling the steering column & EPs unit assembly and the universal joint assembly.

- Tightening torque: 30~35 N.m
(3.0~3.5 kgf.m, 22~25 lbf.ft)

